



UL LLC
1075 W Lambert Rd Suite B
Brea, CA 92821

Outdoor Distribution Test Report

Relevant Standards
IES LM-79-2008, ANSI C82.77-2002

Prepared For
Express Imaging Systems LLC dba Evluma

Blake Coudriet
3600 Lind Ave SW Suite 140
Renton, WA 98057
United States

Catalog Number
AX-55-50-5-D-BR

Order Number
12500748
Test Number
12500748.01

Test Date

2018-09-12

Prepared By

William Escobar, Technician

Approved By

Eric Gaudreau, Engineering Leader

The results contained in this report pertain only to the tested sample.
This report shall not be reproduced, except in full, without written approval of Underwriters Laboratories.
This report must not be used by the client to claim product certification, approval, or endorsement by
NVLAP, NIST, or any agency of the Federal Government.



Luminaire Description: Gray metal housing, white plastic reflector and dome glass lens
Lamp: One (1) white LED with optic below
Mounting: Pole/Arm

Luminaire



Luminaire Characteristics

Luminous Diameter: 11.00 in.
Luminous Height: 1.25 in.

Summary of Results

Roadway Classification: Type V, Short
Cutoff Classification: Cutoff
BUG Rating: B3 U2 G1

Test Conditions


Test Temperature: 24.7 °C
Voltage: 120.0 VAC
Current: 0.4722 A
Power: 56.51 W
Power Factor: 0.997
Frequency: 60 Hz
Current THD: 6.64 %

Tested in 30 planes left side, 30 planes right side, left and right averaged
Vertical test increments are 2.5 degrees
Test distance exceeds five times the greatest luminous opening of luminaire

Laboratory results may not be representative of field performance
Ballast factors have not been applied



IES "BUG" Rating
 (Back Light, Uplight, Glare)
 Per IES TM-15-11

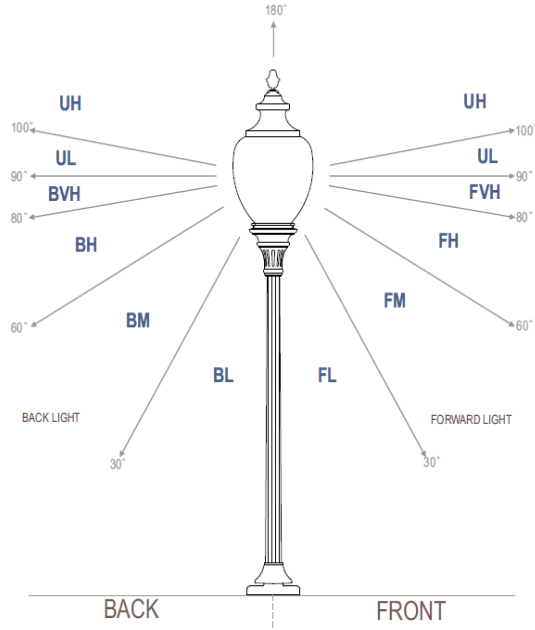

Luminaire Classification System (LCS)

LCS	Zone	Lumens	Luminaire %
FL	(0-30)	352.4	4.4%
FM	(30-60)	2061.6	25.5%
FH	(60-80)	1557.4	19.3%
FVH	(80-90)	56.4	0.7%
BL	(0-30)	352.4	4.4%
BM	(30-60)	2061.6	25.5%
BH	(60-80)	1557.4	19.3%
BVH	(80-90)	56.4	0.7%
UL	(90-100)	21.5	0.3%
UH	(100-180)	7.0	0.1%
Total		8084.2	100.0%
BUG Rating	B3 U2 G1		